

IEEE 802.17 Maintenance Request 0002

MR number 0002 Classification Technical Date received 1/24/2005 **Reserved for official 802.17 use**

Standard 802.17-2004 Page 336 Subclause 11.6.5.1 Figure _____ Table _____

Surname Chathnath Given Name Praveen

Perceived Problem [If more space is needed, please provide an additional file, preferably as plain text.]

MS-MS scenario does not retain closed ring topology as described in Figure 11.29. Two Manual switches retain single EDGE caused by the first Manual Switch.

Proposed Remedy [If more space is needed, please provide an additional file, preferably as plain text.]

The Figure 11.29 and all the associated text should be updated to capture that if there is a Manual Switch present in the ring, second Manual Switch directive would be rejected.

Rationale For Remedy [If more space is needed, please provide an additional file, preferably as plain text.]

Rationale is captured in the txt file MR_MS-MS-Rationale.txt

Remedy's Effect On Existing Equipment [If more space is needed, provide an additional file, preferably as plain text.]

Should not affect the existing 802.17 equipment.

When you have completed this form, please mail it to STDS-802-17-MR @ listserv.ieee.org.