

IEEE 802.17 Maintenance Request 0045

MR number 0045 Classification Technical Date received 3/14/2005 **Reserved for official 802.17 use**

Standard 802.17-2004 Page 333 Subclause 11.6.4.4 Figure _____ Table 11.14

Surname Sultan Given Name Bob

Perceived Problem [If more space is needed, please provide an additional file, preferably as plain text.]

The protMisconfigDefect is not cleared even after the configuration mismatch has been corrected. This occurs because topoChanged is not set to TRUE in Table row 11.14.11 when a TpFrame is received with a new value tpFrame.prefs.wc. As a result, protMisconfigDefect = MismatchedProtection() is not invoked by table row 11.16.9, and protMisconfigDefect is not cleared unless a topology change subsequently occurs. (request submitted on behalf of Wendy Lao who found this problem).

Proposed Remedy [If more space is needed, please provide an additional file, preferably as plain text.]

Insert the action topoChanged = TRUE in Table row 11.14.11.

Rationale For Remedy [If more space is needed, please provide an additional file, preferably as plain text.]

Simple change that fixes problem.

Remedy's Effect On Existing Equipment [If more space is needed, provide an additional file, preferably as plain text.]

None except to fix problem.

When you have completed this form, please mail it to STDS-802-17-MR @ listserv.ieee.org.