

IEEE 802.17 Maintenance Request 0020

MR number 0020 Classification Technical Date received 3/13/2005 **Reserved for official 802.17 use**

Standard 802.17-2004 Page 594 Subclause E.2.4 Figure E.8 Table _____

Surname Lemon Given Name John

Perceived Problem [If more space is needed, please provide an additional file, preferably as plain text.]

The frame example shown in Figure E.8 shows the protocolType, and therefore the FCS, starting at the wrong offset into the frame.

Proposed Remedy [If more space is needed, please provide an additional file, preferably as plain text.]

Show protocolType (and therefore FCS) starting 16 bits into a 32-bit alignment of the frame.

Rationale For Remedy [If more space is needed, please provide an additional file, preferably as plain text.]

Someone implementing what the figure shows would start the FCS 8 bits too early.

Remedy's Effect On Existing Equipment [If more space is needed, provide an additional file, preferably as plain text.]

New equipment with this fixed will not interoperate with equipment already deployed with an incorrect offset for starting the FCS calculation.

When you have completed this form, please mail it to STDS-802-17-MR @ listserv.ieee.org.