

## IEEE 802.17 Maintenance Request 0053

MR number 0053 Classification Technical Date received 3/15/2005 **Reserved for official 802.17 use**

Standard 802.17-2004 Page 525 Subclause D.6 Figure \_\_\_\_\_ Table \_\_\_\_\_

Surname Lemon Given Name John

**Perceived Problem** [ If more space is needed, please provide an additional file, preferably as plain text. ]

The control frames counters in RprSpanCountersStatsEntry are in the wrong location.

**Proposed Remedy** [ If more space is needed, please provide an additional file, preferably as plain text. ]

Move the control frames counters from RprSpanCountersStatsEntry (and associated span tables) to RprClientCountersStatsEntry (and associated client tables).

**Rationale For Remedy** [ If more space is needed, please provide an additional file, preferably as plain text. ]

The standard counts control frames at client receive (Table 7.26) and client transmit (Table 7.33), and does not count control frames separately at span receive (Table 7.21) and span transmit (Table 7.36).

**Remedy's Effect On Existing Equipment** [ If more space is needed, provide an additional file, preferably as plain text. ]

None.

**When you have completed this form, please mail it to STDS-802-17-MR @ listserv.ieee.org.**