

# IEEE 802.17 Maintenance Request 0091

MR number 0091 Classification Technical Date received 11/7/2005 **Reserved for official 802.17 use**

Standard 802.17-2004 Page 132 Subclause 7.6.3.6.4 Figure \_\_\_\_\_ Table 7.20

Surname Bruckman Given Name Leon

**Perceived Problem** [ If more space is needed, please provide an additional file, preferably as plain text. ]

According to Table 7.20 row 27 Fairness frames are not checked for wrong ringlet, since they skip row 38. If a Multichoke fairness frame (MCFF) is caught in the wrong ringlet it will stay forever. Note that the source of the MCFF removes it only if it is in the right ringlet, as defined in Table 7.22 row 7

**Proposed Remedy** [ If more space is needed, please provide an additional file, preferably as plain text. ]

Remove row 27 from Table 7.20

**Rationale For Remedy** [ If more space is needed, please provide an additional file, preferably as plain text. ]

Minimum change

**Remedy's Effect On Existing Equipment** [ If more space is needed, provide an additional file, preferably as plain text. ]

No impact, since the change only fixes a potential problem, and is fully inteoperable with standard compliant equipment.

**When you have completed this form, please mail it to STDS-802-17-MR @ listserv.ieee.org.**