

## IEEE 802.17 Maintenance Request 0119

MR number 0119 Classification Technical Date received 9/15/2006 **Reserved for official 802.17 use**

Standard 802.17-2004 Page 172 Subclause 7.7.4 Figure \_\_\_\_\_ Table \_\_\_\_\_

Surname Juźwiak Given Name Piotr

**Perceived Problem** [ If more space is needed, please provide an additional file, preferably as plain text. ]

Frame.hec field is set in RingletSelection state machine (i.e. rows 34, 37) and next in StageQueueSelection the frame content is changed (fields frame.fe and frame.sc) so finally hec field value may be incorrect for frame header.

**Proposed Remedy** [ If more space is needed, please provide an additional file, preferably as plain text. ]

Move frame.hec setting from RingletSelection state machine to e.g. StageQueueSelection state machine to point after setting frame.sc and frame.fe values..

**Rationale For Remedy** [ If more space is needed, please provide an additional file, preferably as plain text. ]

Frame.hec value of frame will get a proper value during transmit operations.

**Remedy's Effect On Existing Equipment** [ If more space is needed, provide an additional file, preferably as plain text. ]

Fix the problem only.

**When you have completed this form, please mail it to STDS-802-17-MR @ listserv.ieee.org.**