

Some Comments on Annex 149B.3.2

July 15, 2019

Mike Tu tum@broadcom.com

Annex 149B.3.2


- The state diagram parameters do not seem to match well with the OAM register mapping in Table 149-9.
- I think Figure 149B-2 and Figure 149B-3 should be modified as well.
- General principle:
 - Make all variable and counter names start with mr_xxxx
 - Values of all variable should be either true or false, instead of 0 or 1
- See the proposed changes in the following slides.


Changes to variable and counter names

- 149B.3.2.1, page 199, line 7.
 - Change variable name “rx_clear_rec” to “mr_rx_clear_rec”.
- 149B.3.2.1, page 199, line 13.
 - Change variable name “tx_clear_rec” to “mr_tx_clear_rec”.
- 149B.3.2.2, page 199, line 21.
 - Change counter name “tx_rec” to “mr_tx_rec”.
- 149B.3.2.1, page 199, line 1.
 - Variable “mr_tx_request_rec_clear” does not match to any register bits in Table 149-9. It also looks like a duplicate of the “tx_clear_rec” variable.
 - Propose to delete line 1 to 5.

Update Figure 149B-3

- In 149B.3.2.3, page 200, line 38, Figure 149B-3, make the changes as highlighted in RED.

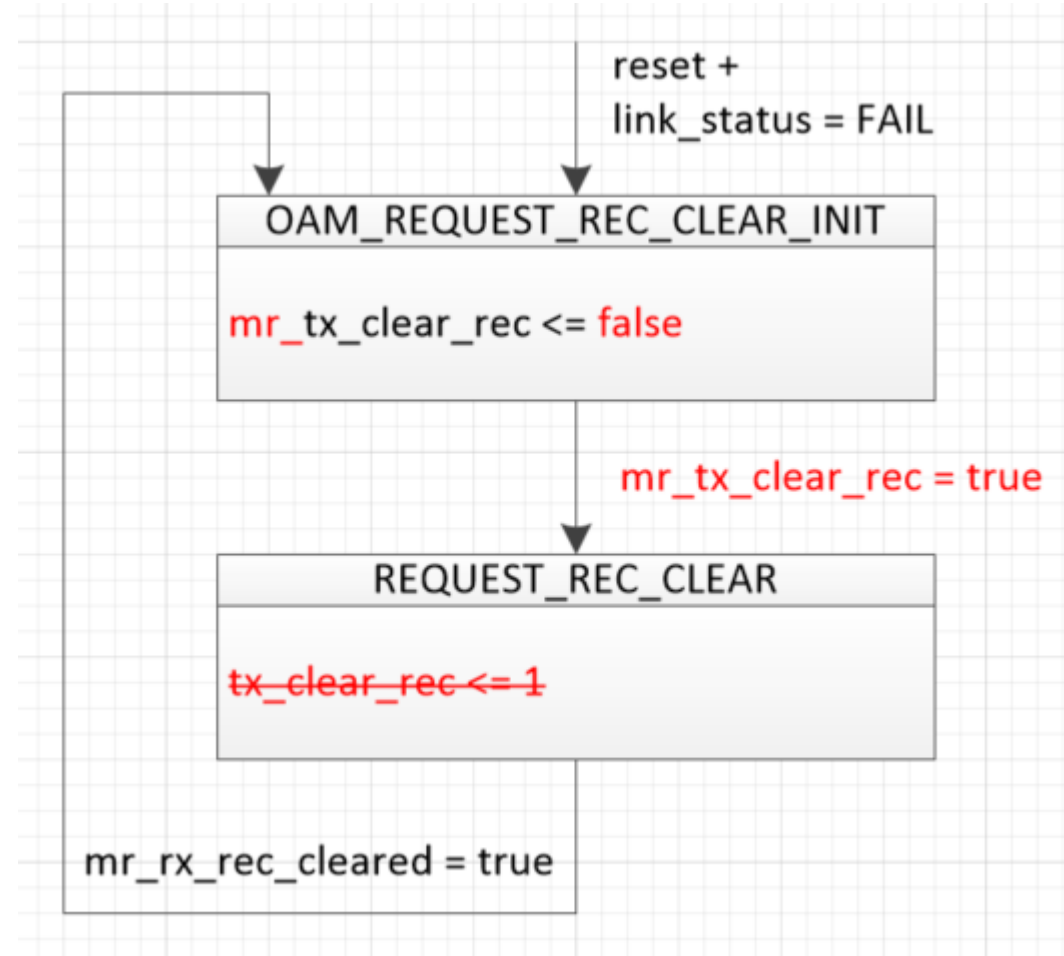

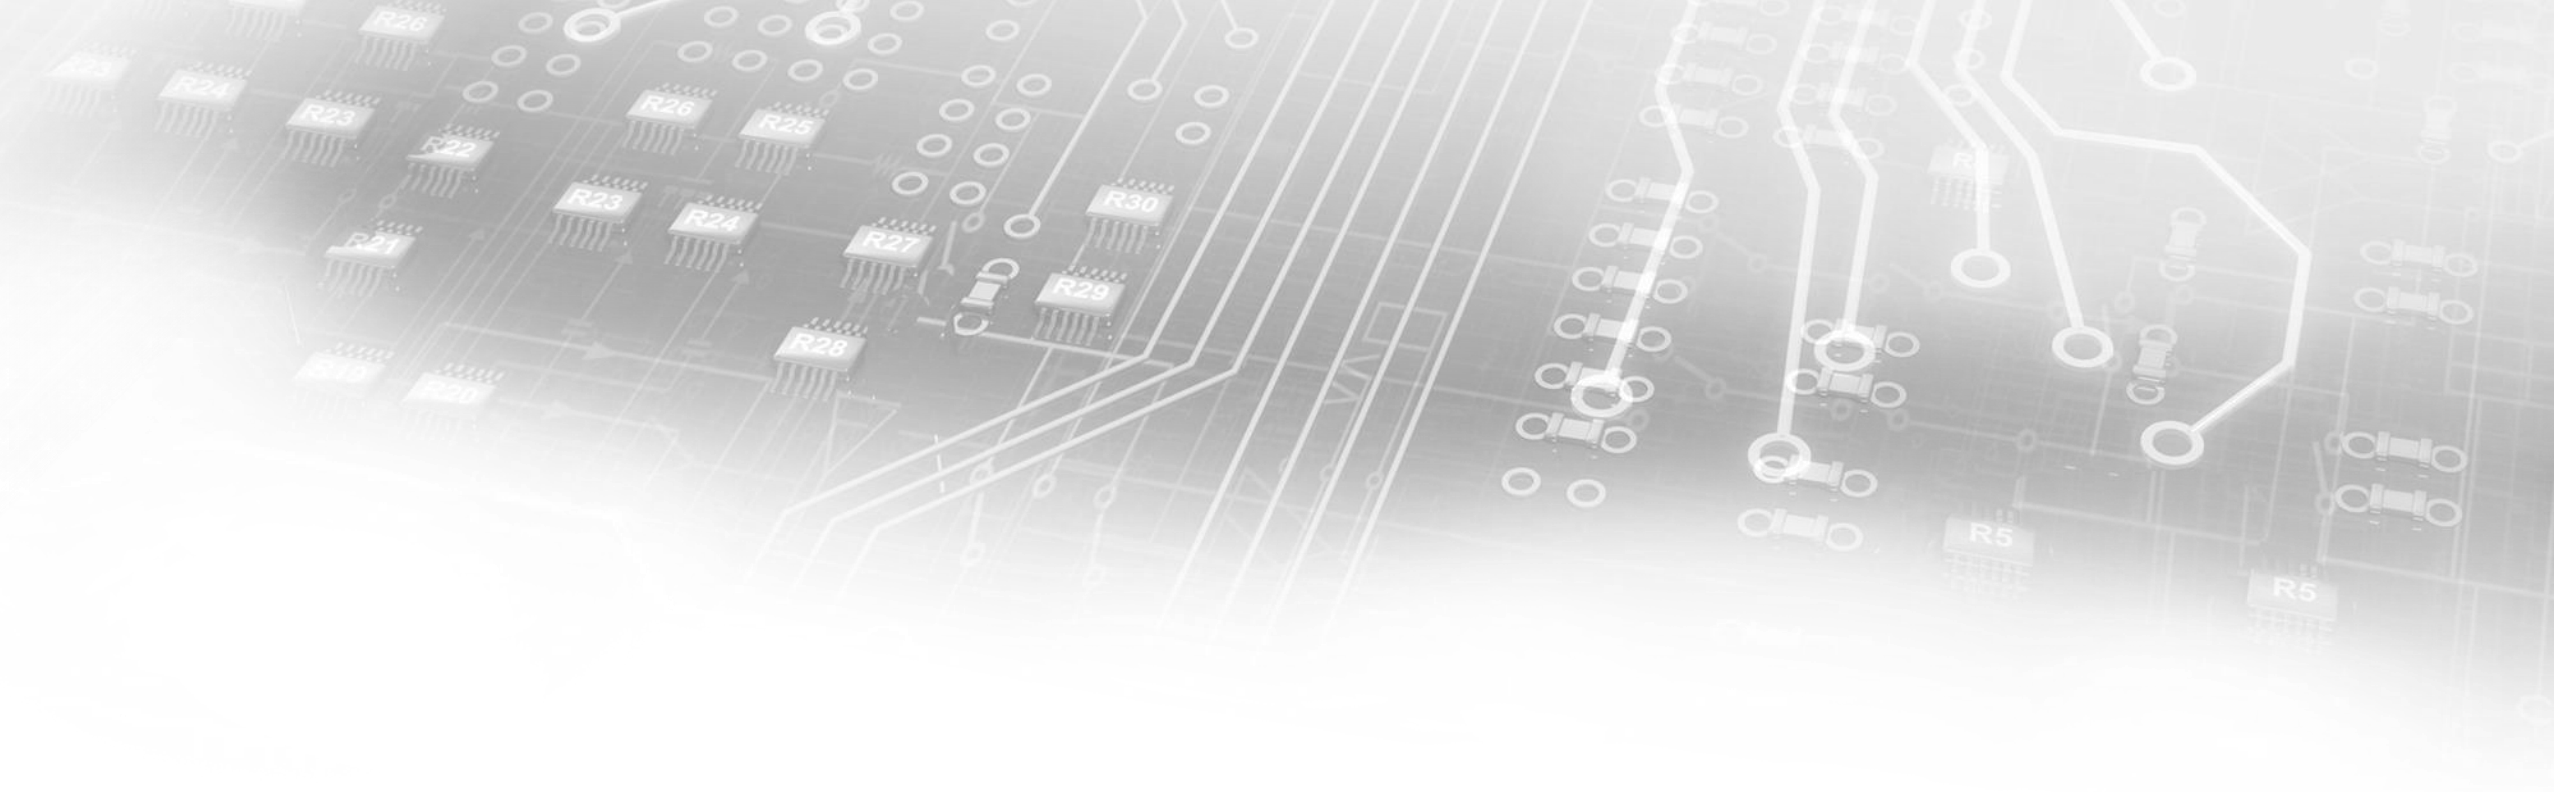

THANK YOU
